

for and on behalf of
PYPUN - BALFOURS
CONSULTING ENGINEERS

WITHDRAWN
By BSEN 22553:1991

Welding terms and symbols


Part 2. Specification for symbols for welding

Termes et symboles relatifs au soudage
Partie 2. Spécification des symboles relatifs au soudage

Begriffe und Symbole der Schweisstechnik
Teil 2. Spezifikation für Symbole der Schweisstechnik

*Standard Steel
Team.
Don't take away*

for and on behalf of
PYPUN - BALFOURS
CONSULTING ENGINEERS

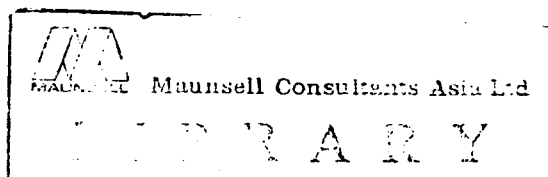

Contents

	Page		Page
Foreword	Inside front cover	7. Examples of use of symbols for compound welds	14
Cooperating organizations	Back cover	8. Examples of combinations of elementary and supplementary symbols	15
Specification		9. Main dimensions	16
1. Scope	1	10. Numerical indication of process	18
2. References	1	Figures	
3. Symbols	1	1. Method of representation	1
4. Position of symbols	1	2. T-joint with one fillet weld	2
5. Dimensions	3	3. Cruciform joint with two fillet welds	2
6. Complementary indications	3	4. Position of the arrow line	2
7. Marking	3	5. Example of the indication of dimensions	3
Tables		6. Use of symbols for bevel groove welds	3
1. Elementary symbols	5	7. Use of symbols for fillet welds	3
2. Supplementary symbols	5	8. Symbol for non-destructive testing	3
3. Examples of application of supplementary symbols	5	9. Example of the indication of process	3
4. Position of the symbol	6		
5. Examples of the use of elementary symbols	7		
6. Examples of combinations of elementary symbols	12		

Foreword

The revision of this Part of BS 499 has been carried out under the direction of the Welding Standards Committee to take account of the requirements of ISO 2553-1974 published by the International Organization for Standardization (ISO). As a result the general content and presentation have been changed to align with ISO 2553.

The elementary symbols depict the form of the weld to be made regardless of the welding process to be employed, which was not always the case with the symbols in the previous edition of this standard. These symbols may be qualified by the use of supplementary symbols, dimensional details and complementary indications.

In the absence of a single method being agreed internationally, ISO 2553 provisionally recognizes that the position of the symbol relative to the reference line should depend on the method of drawing projection used in the particular

case. It was felt that this situation should not be carried over into this standard and therefore the practice of placing the symbol below the reference line for welds on the 'arrow side' remains unaltered in this revision, for both third and first angle projection. Because of the existence of two systems of positioning the symbol, however, it is strongly recommended that all drawings should clearly state which system has been employed.

In order to simplify drawings, it is recommended that requirements relating to the preparation and making of welds should be included on the welding procedure sheets. For typical information to appear on welding procedure sheets for various processes, reference should be made to the appendices in BS 499 : Part 1, while an example of the layout of a typical welding procedure test record is given in the appendix of BS 4870 : Part 1.

British Standard

Welding terms and symbols

Part 2. Specification for symbols for welding

1. Scope

This Part of BS 499 specifies requirements for the symbolic representation of welds on drawings. For the most common types of weld the scheme provides basic indications regarding the welds to be made without over-burdening the drawing with notes or showing an additional view. The scheme is not intended to apply to complex joints, involving multiple welds for example, for which it may be simpler to show on the drawing a separate detailed view of the joint and welds required.

2. References

The titles of the standards publications referred to in this standard are listed on the inside back cover.

3. Symbols

3.1 Elementary symbols. The various types of weld are each characterized by a symbol which, in general, is representative of the shape of the weld to be made or the edge preparation to be used. The symbol is not to be taken to pre-judge the welding process to be employed.

The type of weld shall be indicated by the appropriate elementary symbol given in table 1. Examples are given in table 5. The vertical portions of the symbols for single-bevel butt, single-J butt and fillet welds shall always be on the left-hand side of the symbol irrespective of the orientation of the weld metal. The symbols shall apply to the respective welds regardless of the number of runs to be deposited, whether or not there is a root gap and whether or not there is backing material, as such details shall be given on the welding procedure sheet.

3.2 Combinations of elementary symbols. For welds made from two sides, combinations of elementary symbols shall be used. Examples are given in table 6.

In the case of compound welds, e.g. a fillet weld super-

imposed on a single-bevel butt weld, the appropriate combination of symbols shall be used, but the scheme of symbols is not intended to apply to complex joints. Examples are given in table 7.

3.3 Supplementary symbols. When the external surface of the weld is required to be of a particular shape, the appropriate supplementary symbol given in table 2 shall be used in conjunction with the relevant elementary symbol. Examples are given in tables 3 and 8.

4. Position of symbols

4.1 General. The symbols shall be used in conjunction with an arrow line and a reference line. Their method of representation is shown in figure 1.


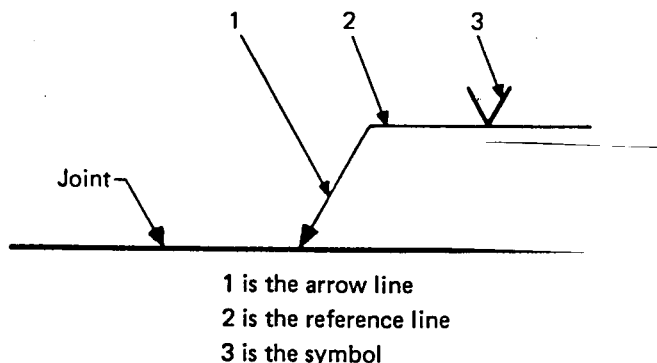



Figure 1. Method of representation

4.2 Arrow line relative to the joint. To indicate the position of a weld in a particular joint relative to the parts being joined, the 'head' of an arrow shall be used to denote the 'reference side' of the joint. The side nearer the arrow head shall be known as the 'arrow side' and the remote side as the 'other side'. Examples are given in figures 2 and 3.

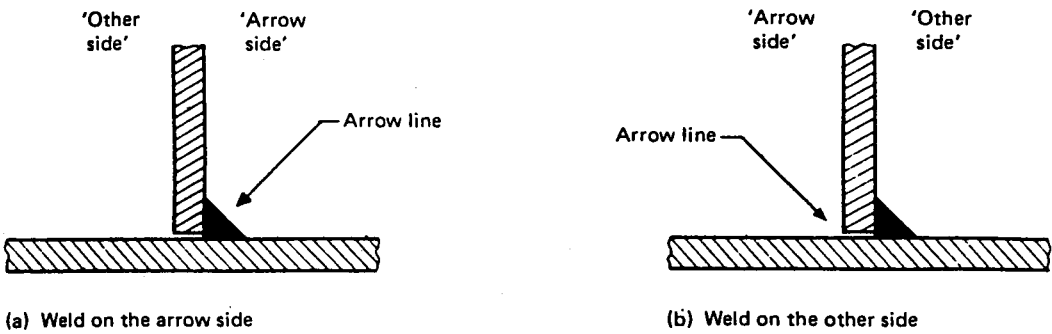

NOTE. The position of the arrow in these sketches is chosen for purposes of clarity. Normally, it would be placed immediately adjacent to the joint.

Figure 2. T-joint with one fillet weld

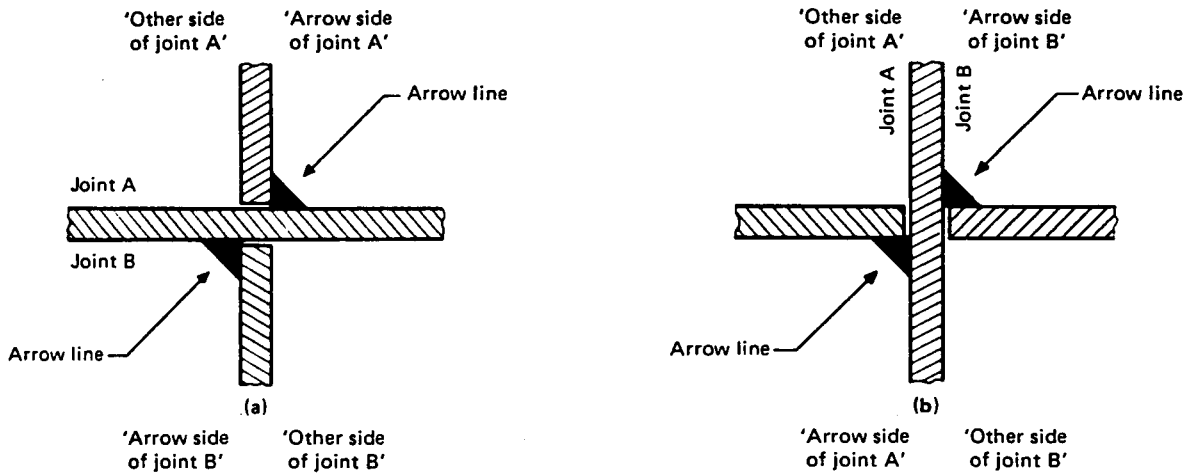

NOTE. The position of the arrow in these sketches is chosen for purposes of clarity. Normally, it would be placed immediately adjacent to the joint.

Figure 3. Cruciform joint with two fillet welds

4.3 Position of the arrow line. The position of the arrow line with respect to the weld is generally of no special significance, but in the case of joints in which only one part is prepared the arrow shall point towards that part.

The arrow line shall join one end of the reference line such that it forms an angle with it. Examples are given in figure 4.

NOTE. When the arrow cannot point to a joint, symbolic representation cannot be used.

4.4 Position of the reference line. The reference line shall be a straight line preferably drawn parallel to the bottom edge of the drawing.

4.5 Symbol relative to the reference line. The position of the symbol relative to the reference line shall be in accordance with the requirements of table 4, irrespective of the method of drawing projection employed.

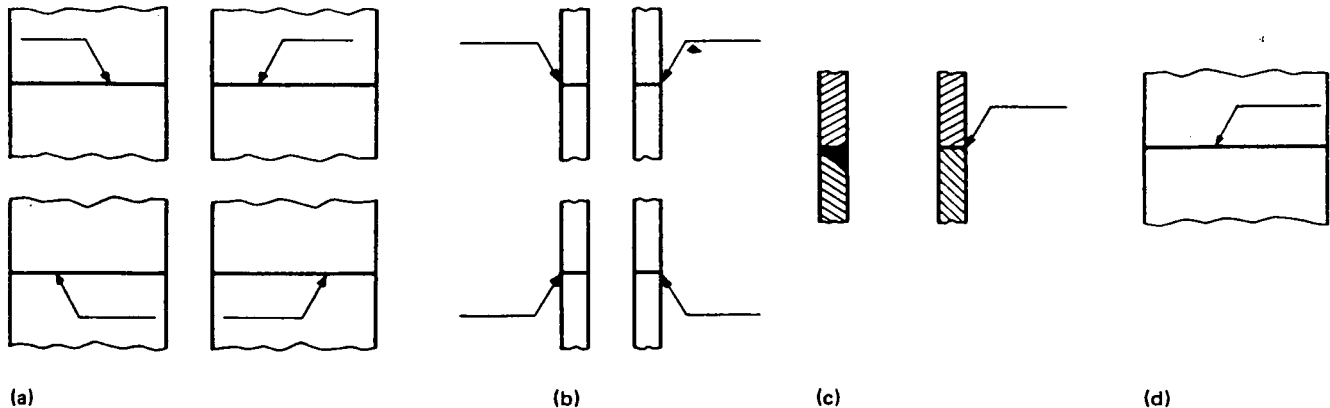


Figure 4. Position of the arrow line

5. Dimensions

5.1 General. Where a symbol is accompanied by a certain number of dimensions, expressed in millimetres, the indication of these dimensions, illustrated in figure 5, shall be as follows:

- (a) dimensions relating to the cross section of the weld shall be given on the left-hand side of the symbol;
- (b) longitudinal dimensions shall be given on the right-hand side of the symbol; distances between adjacent weld elements shall be indicated in parenthesis.

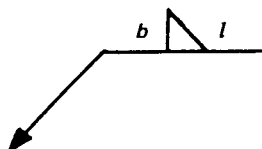


Figure 5. Example of the indication of dimensions

The main dimensions to be indicated, and how they are used, shall be as given in table 9. Any other significant dimensions shall be included on the welding procedure sheets. The dimensions that locate the weld in relation to the edges of the parts being welded shall be given on the drawing.

5.2 Butt welds. In the absence of any dimensional indications to the contrary, it shall be taken that butt welds are intended to have full penetration and to be continuous along the entire length of the joint.

5.3 Fillet welds. In the absence of any dimensional indications to the contrary, it shall be taken that fillet welds are intended to be continuous along the entire length of the joint.

The cross-sectional dimension to be indicated for a fillet weld shall be the leg length. When it is also desired to indicate the design throat thickness, then the leg length dimension shall be prefixed with the letter 'b' and the design throat thickness dimension shall be prefixed with the letter 'a'.

In the case of a fillet weld having unequal legs, the orientation of the weld shall be indicated on the drawing, unless the formation of the joint makes this obvious, and both leg length dimensions shall be given, separated by a multiplication sign.

NOTE. The following preferred range of leg length dimensions, in millimetres, should be used for the dimensioning of fillet welds: 3, 4, 5, 6, 8, 10, 12, 16, 18, 20, 22 and 25.

6. Complementary indications

6.1 Peripheral welds. Where a weld is to be made all round a joint, this shall be indicated by a circle placed where the arrow line joins the reference line, as shown in figure 6.

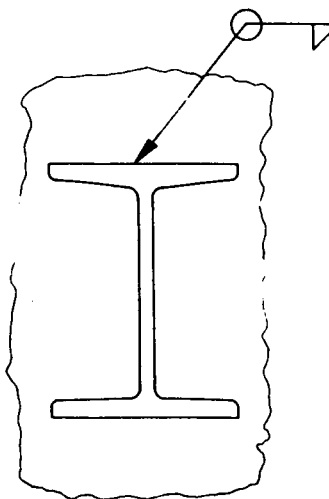


Figure 6. Use of symbol for peripheral welds

6.2 Site welds. Welds to be made on site shall be differentiated from shop welds by the indication of a flag where the arrow line joins the reference line, as shown in figure 7.

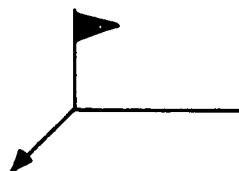


Figure 7. Use of symbol for site welds

6.3 Non-destructive testing. When it is desired to indicate that non-destructive testing, other than visual examination, of a weld is required, the symbol shown in figure 8 shall be placed near to the end of the reference line.

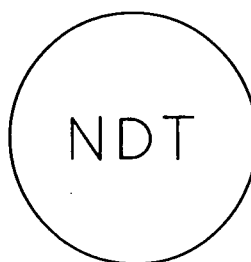


Figure 8. Symbol for non-destructive testing

6.4 Welding process. Information regarding the welding process to be used is given on the welding procedure sheet. When it is also desired to indicate the process as part of the symbolic representation, the appropriate number in table 10* shall be placed within a 'fork' at the end of the reference line as shown in figure 9.

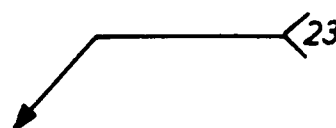


Figure 9. Example of the indication of process

7. Marking

All drawings complying with this standard shall be marked:

The welding symbols on this drawing comply with
BS 499 : Part 2 : 1980.*

AMD 6118

*Complies with International Standard ISO 4063.

Table 1. Elementary symbols

No.	Designation	Illustration	Symbol
1	Butt weld between flanged plates* (the flanges being melted down completely)		
2	Square butt weld†		
3	Single-V butt weld		
4	Single-bevel butt weld		
5	Single-V butt weld with broad root face		
6	Single-bevel butt weld with broad root face		
7	Single-U butt weld		
8	Single-J butt weld		
9	Backing or sealing run		
10	Fillet weld		

*Butt welds between flanged plates (symbol 1) not completely penetrated are symbolized as square butt welds (symbol 2) with the weld thicknesses shown (see table 10).

†This symbol is used to indicate a stud weld when there is no end preparation and no fillet weld.

Table 1. (concluded)

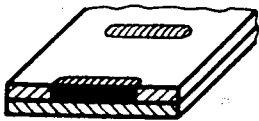

No.	Designation	Illustration	Symbol
11	Plug weld (circular or elongated hole, completely filled)		
12	Spot weld (resistance or arc welding) or projection weld	 (a) Resistance  (b) Arc	
13	Seam weld		







Table 2. Supplementary symbols

Shape of weld surface	Symbol
(a) flat (usually finished flush)	
(b) convex	
(c) concave	

Table 3. Examples of application of supplementary symbols

















Designation	Illustration	Symbol
Flat (flush) single-V butt weld		
Convex double-V butt weld		
Concave fillet weld		
Flat (flush) single-V butt weld with flat (flush) backing run		

Table 4. Position of the symbol*

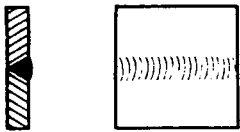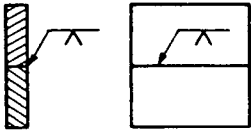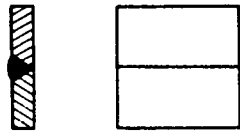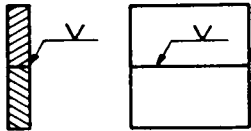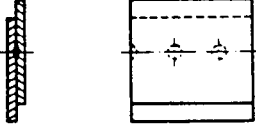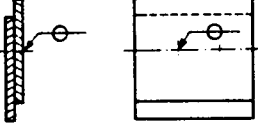Illustration	Graphic representation	Symbolic representation	Description of position
			Below the reference line if the external surface of the weld (weld face) is on the arrow side of the joint.
			Above the reference line if the external surface of the weld (weld face) is on the other side of the joint.
			Across the reference line in the case of welds made within the plane of the joint.

*3rd angle projection.

Table 5. Examples of the use of elementary symbols*

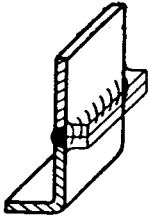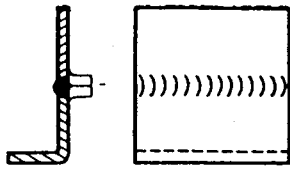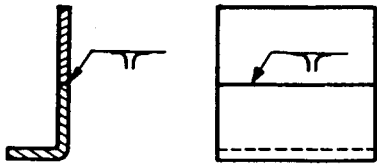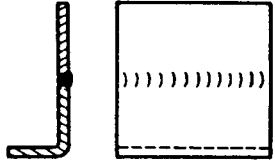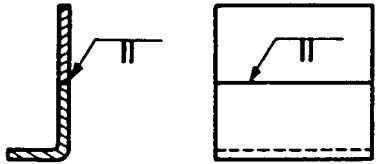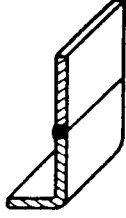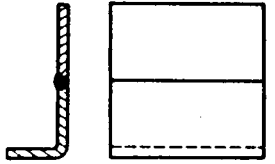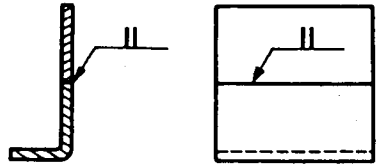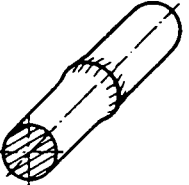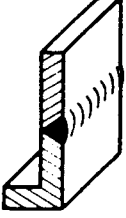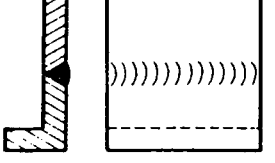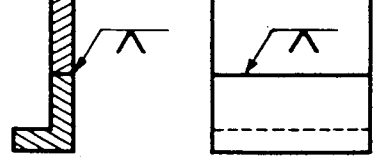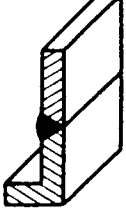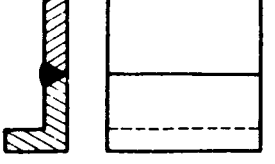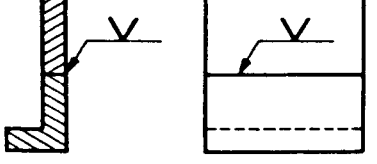No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
1	Butt weld between flanged plates  1			
2	Square butt weld  2			
3				
4				
5	Single-V butt weld  3			
6				

*3rd angle projection.

Table 5. (continued)

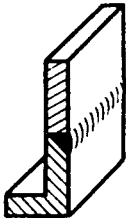
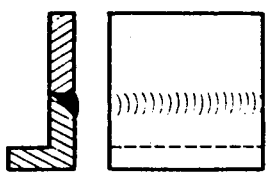
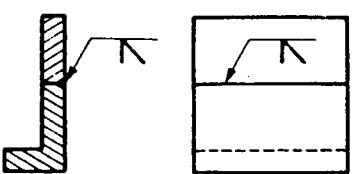
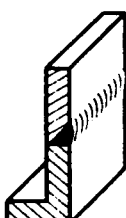
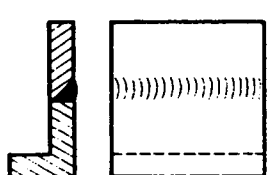
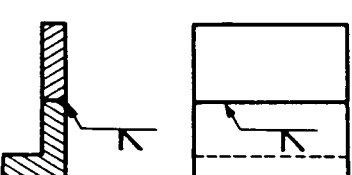
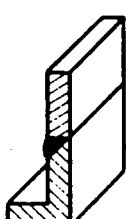
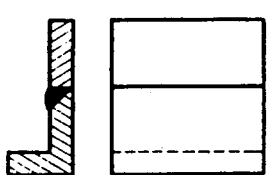
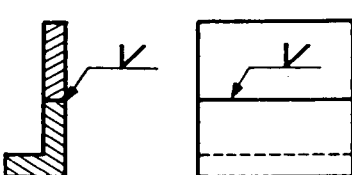
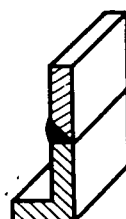
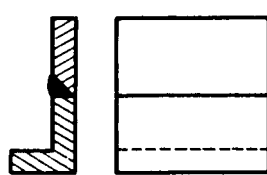
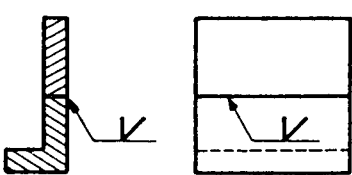
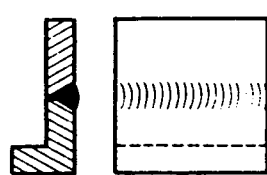
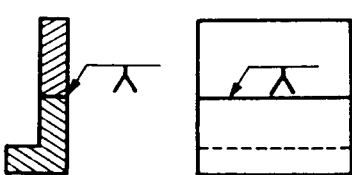
No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
7	Single-bevel butt weld  4			
8				
9				
10				
11	Single-V butt weld with broad root face  5			

Table 5. (continued)

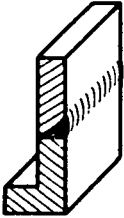
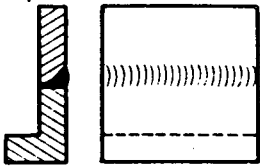
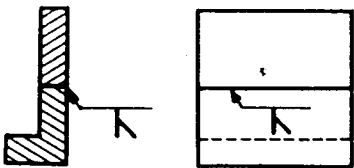
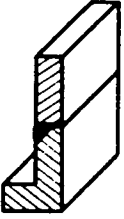
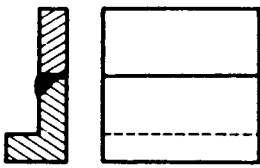
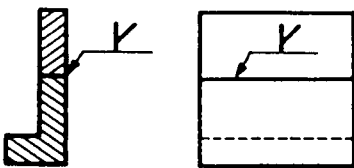
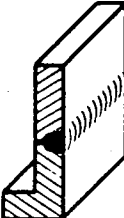
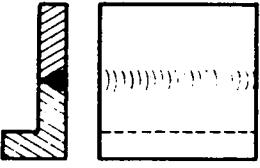
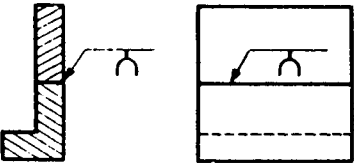
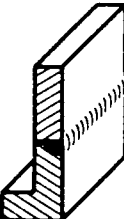
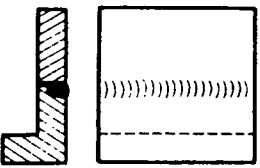
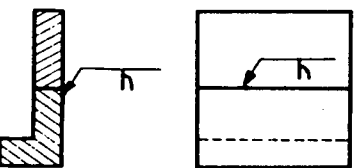
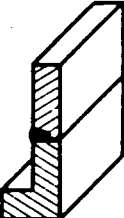
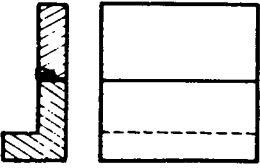
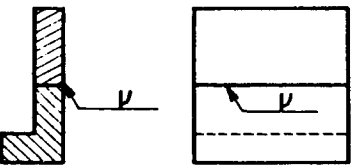
No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
12	Single-bevel butt weld with broad root face  6			
13				
14	Single-U butt weld  7			
15	Single-J butt weld  8			
16				

Table 5. (continued)

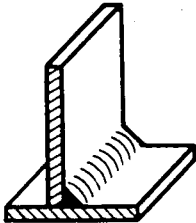
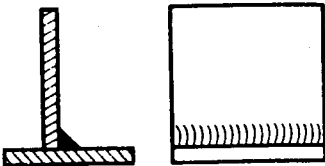
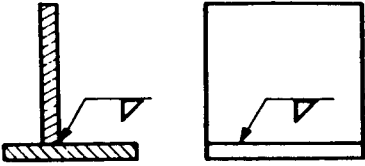
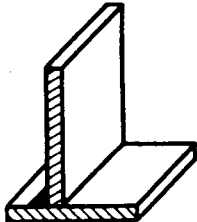
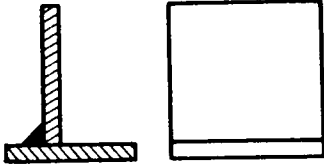
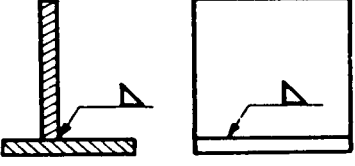
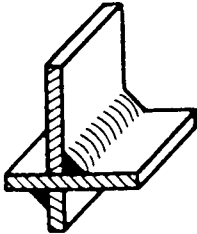
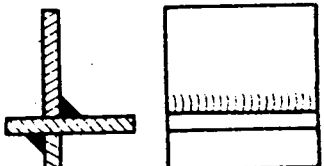
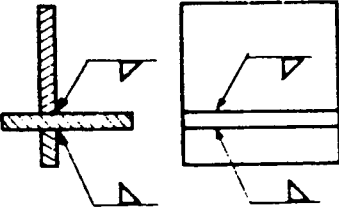
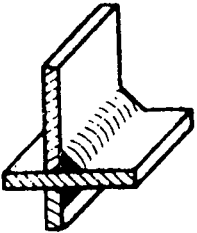
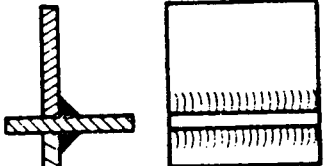
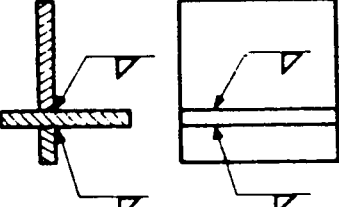
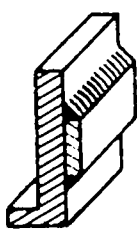
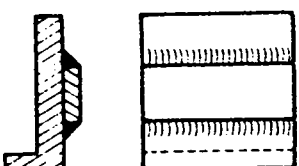
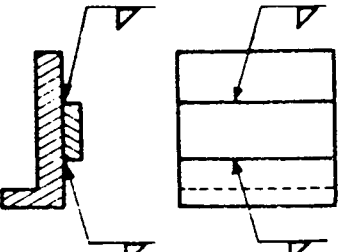
No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
17	Fillet weld 			
18				
19				
20				
21				

Table 5. (concluded)

No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
22	Plug weld 11			
23				
24	Spot weld 12			
25				
26	Seam weld 13			

Table 6. Examples of combinations of elementary symbols

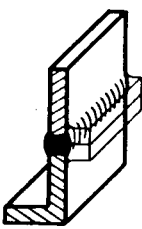
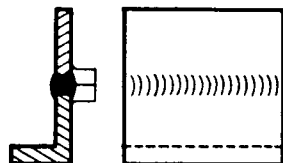
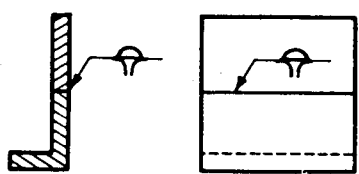
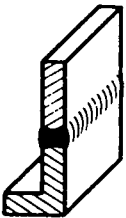
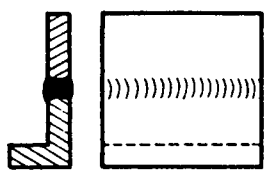
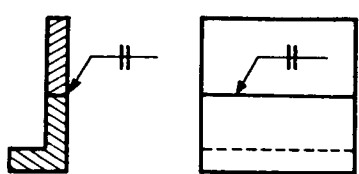
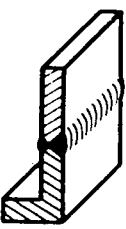
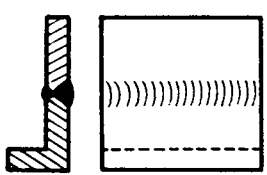
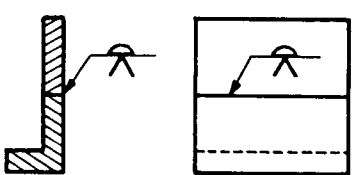
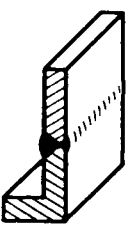
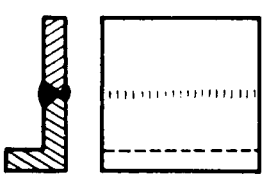
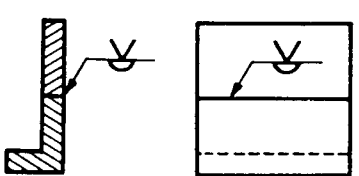
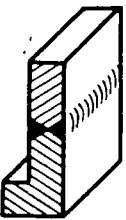
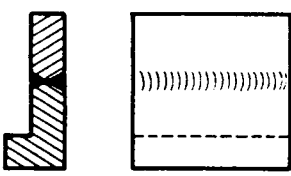
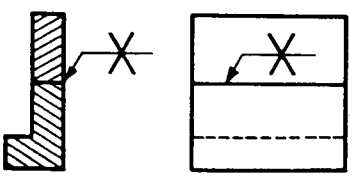
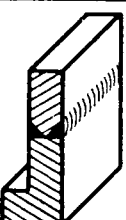
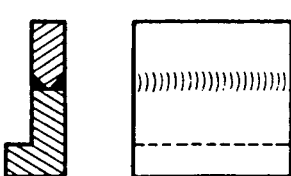
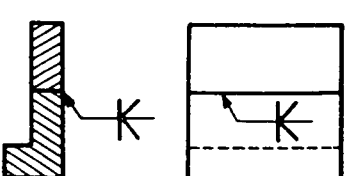
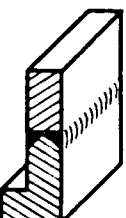
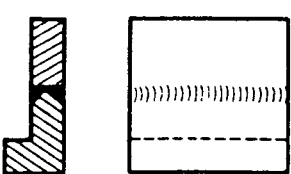
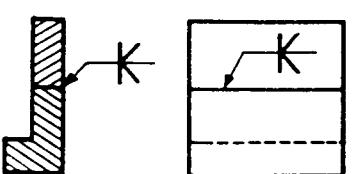
No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
1	Butt weld between flanged plates  1 and backing run  9 1 - 9			
2	Square butt weld  2 welded from both sides 2 - 2			
3	Single-V butt weld  3 and backing run  9 3 - 9			
4	Single-V butt weld  3 and backing run  9 3 - 9			
5	Double-V butt weld  3 (X weld) 3 - 3			
6	Double-bevel butt weld  4 (K weld) 4 - 4			
7	Double-bevel butt weld  4 (K weld) 4 - 4			

Table 6. (concluded)

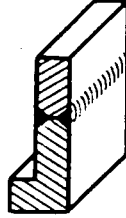
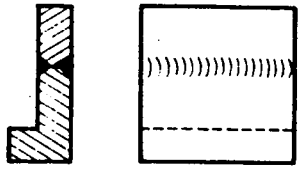
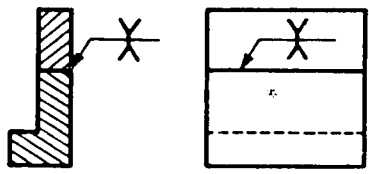
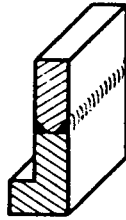
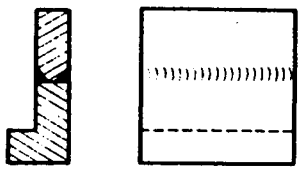
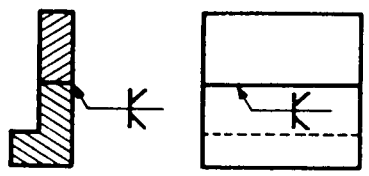
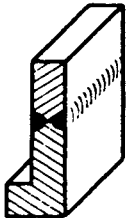
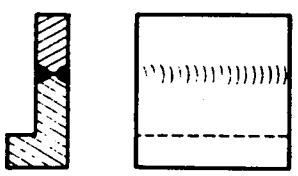
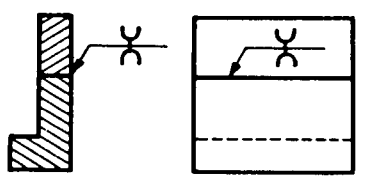
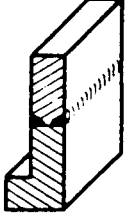
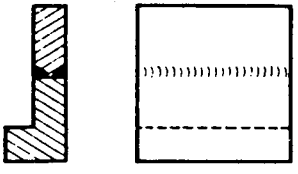
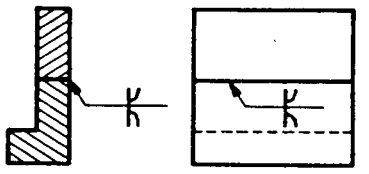
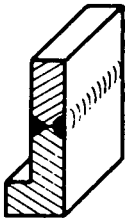
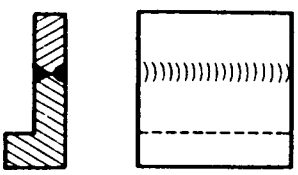
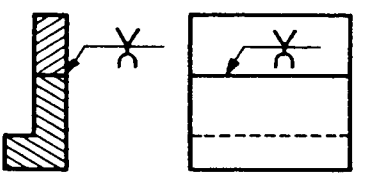
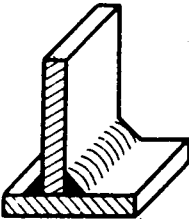
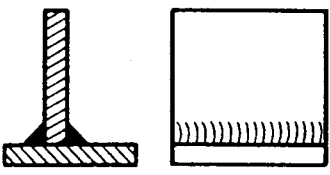
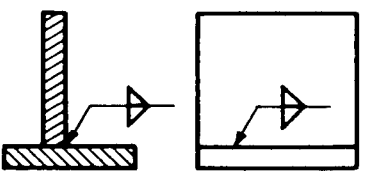
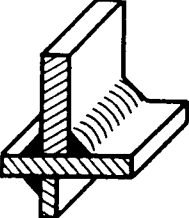
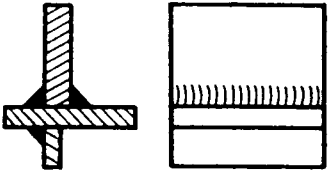
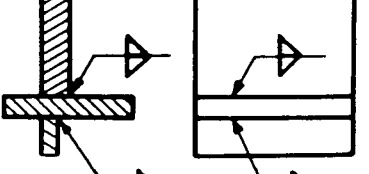
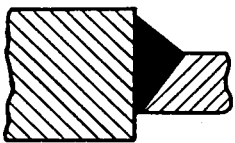
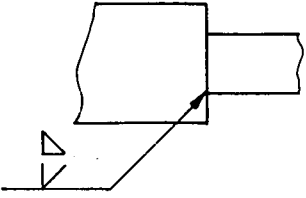
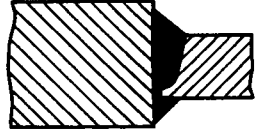
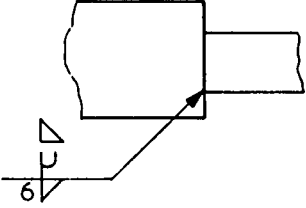
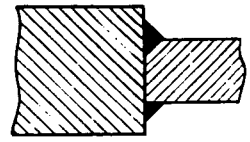
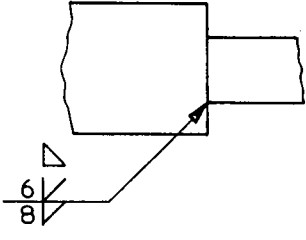
No.	Designation symbol (numbers refer to table 1)	Illustration	Graphic representation	Symbolic representation
8	Double-V butt weld with broad root face  5 5 - 5			
9	Double-bevel butt weld with broad root face  6 6 - 6			
10	Double-U butt weld  7 7 - 7			
11	Double-J butt weld  8 8 - 8			
12	Single-V butt weld  3 and single-U butt weld  7 3 - 7			
13	Fillet weld  10 and fillet weld			
14	 10 10 - 10			

Table 7. Examples of use of symbols for compound welds








No.	Designation symbol (numbers refer to table 1)	Graphic representation	Symbolic representation
1	Single-bevel butt weld with fillet weld superimposed  4  10 4 + 10		
2	Single-J butt weld with fillet weld superimposed  8  10 and with fillet weld on root side  10 8 + 10 - 10		
3	Partial penetration single-bevel butt weld with fillet weld superimposed  4  10 and with fillet weld on arrow side  10 4 + 10 - 10		

*For dimensional requirements see table 9.

Table 8. Examples of combinations of elementary and supplementary symbols

No.	Symbol	Illustration	Graphical representation	Symbolic representation
1				
2				
3				
4				
5				
6				
7				

Table 9. Main dimensions

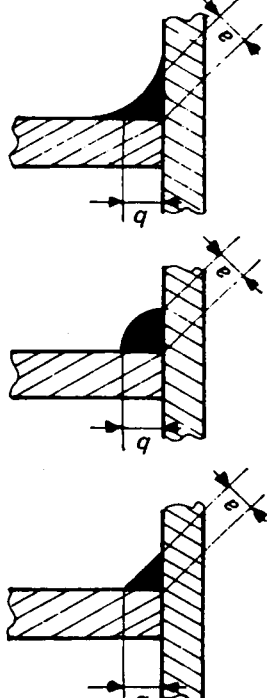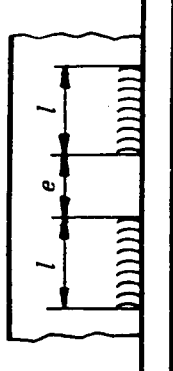No.	Designation of welds	Definition	Inscription
1	Butt weld		 (see 5.2)
			 (see 5.2)
			 (see 5.2)
2	Butt weld between plates with raised edges		 (see 5.2)
3	Continuous fillet weld		 (see 5.3)
4	Intermittent fillet weld		 (see 5.3)

s is the minimum distance from the surface of the part to the bottom of the penetration, which cannot be greater than the thickness of the thinner part.
In the case of partial penetration double sided welds the appropriate dimension shall be used with each symbol above and below the reference line.






s is the minimum distance from the external surface of the weld to the bottom of the penetration.

b is the leg length.

a is the design throat thickness.

l is the length of weld (without end craters).
 e is the distance between adjacent weld elements.
 n is the number of weld elements.
 b a
(see no. 3)

Table 9. (concluded)

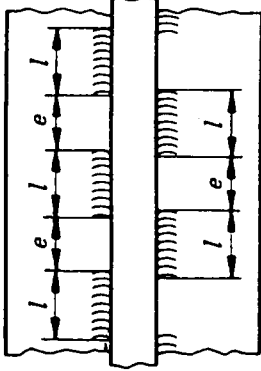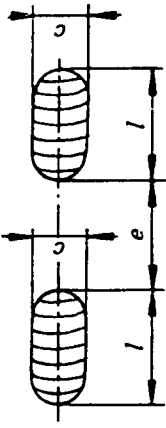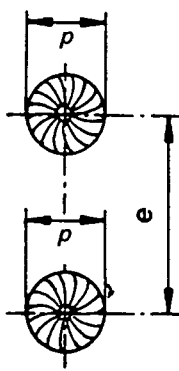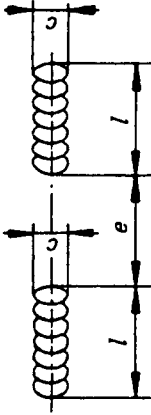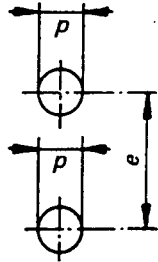
No.	Designation	Definition		Inscription
5	Staggered intermittent fillet weld		$\left. \begin{array}{l} l \\ e \\ n \end{array} \right\} \begin{array}{l} \text{(see no. 4)} \\ \\ \end{array}$ $\left. \begin{array}{l} b \\ a \end{array} \right\} \begin{array}{l} \text{(see no. 3)} \\ \\ \end{array}$	$\frac{b}{b} \frac{n \times l}{n \times l} \left[\frac{e}{e} \right]$ $\frac{b a}{b a} \frac{n \times l}{n \times l} \left[\frac{e}{e} \right]$ (see 5.3)
6	Plug weld	 	$\left. \begin{array}{l} e \\ n \end{array} \right\} \begin{array}{l} \text{(see no. 4)} \\ \\ \end{array}$ $\left. \begin{array}{l} l \\ e \\ d \end{array} \right\} \begin{array}{l} \text{is the length of slot} \\ \text{is the width of slot} \\ \text{is the diameter of hole} \end{array} \left. \begin{array}{l} \text{dimensions at base of slot} \\ \text{if bevelled sides} \end{array} \right\}$ (dimension at base if bevelled side)	$c \quad \sqcap \quad n \times l (e)$ $d \quad \sqcap \quad n \times (e)$
7	Seam weld		$\left. \begin{array}{l} l \\ e \\ n \end{array} \right\} \begin{array}{l} \text{(see no. 4)} \\ \\ \end{array}$ c is the width of weld	$c \quad \text{---} \quad n \times l (e)$
8	Spot weld		$\left. \begin{array}{l} n \\ e \\ d \end{array} \right\} \begin{array}{l} \text{(see no. 4)} \\ \text{is the spacing} \\ \text{is the diameter of spot} \end{array}$	$d \quad \bigcirc \quad n \times (e)$

Standards publications referred to

- BS 499* Welding terms and symbols
Part 1 Welding, brazing and thermal cutting glossary
- BS 4870* Approval testing of welding procedures
Part 1 Fusion welding of steel
- ISO 2553* Welds — Symbolic representation on drawings
- ~~ISO 4063~~ ~~Welding, brazing, braze welding and soldering of~~
~~metals — List of processes, for symbolic representation~~
~~on drawings~~

'BS EN 24063 : 1992 Welding, brazing, soldering and braze welding of metals — Nomenclature of processes and reference numbers for symbolic representation on drawings'

AMD 7439

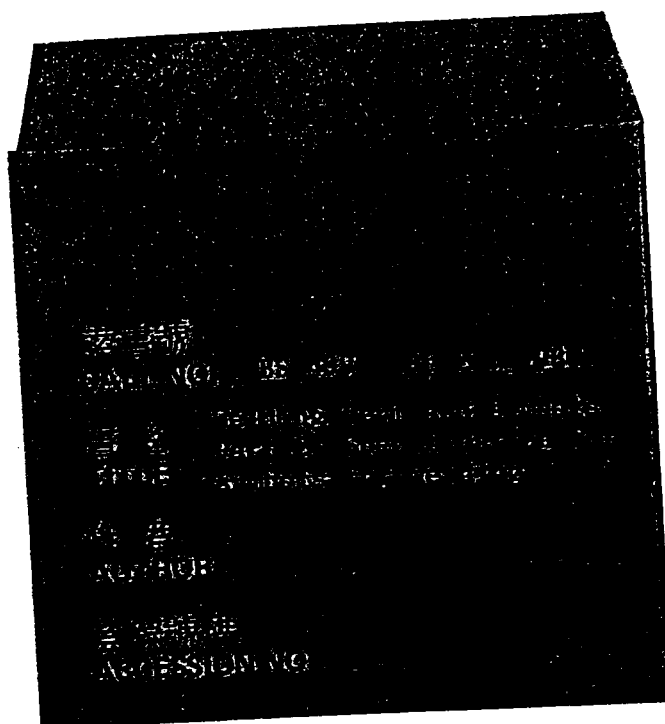

* Referred to in the foreword only.

This British Standard, having been prepared under the direction of the Welding Standards Committee, was published under the authority of the Executive Board and comes into effect on 30 April 1980.

© British Standards Institution, 1980

First published August 1933

First revision June 1939

Second revision October 1952

Third revision October 1965

Fourth revision April 1980

ISBN 0 580 11255 1

British Standards Institution

Incorporated by Royal Charter, BSI is the independent national body for the preparation of British Standards. It is the UK member of the International Organization for Standardization and UK sponsor of the British National Committee of the International Electrotechnical Commission.

Copyright

Users of British Standards are reminded that copyright subsists in all BSI publications. No part of this publication may be reproduced

in any form without the prior permission in writing of BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols and size, type or grade designations. Enquiries should be addressed to the Publications Manager, 101 Pentonville Road, London N1 9ND (Telephone 01-837 8801 ; Telex 23218).

Contract requirements

Attention is drawn to the fact that this British Standard does not purport to include all the necessary provisions of a contract.

Revision of British Standards

British Standards are revised, when necessary, by the issue either of amendment slips or of revised editions. It is important that users of British Standards should ascertain that they are in possession of the latest amendments or editions. Information on all BSI publications is in the *BS Yearbook*, supplemented each month by *BSI News* which is available to subscribing members of the Institution and gives details of new publications, revisions, amendments and withdrawn standards.

The following BSI references relate to the work on this standard: Committee reference WEE/1 Draft for comment 77/78681 DC

Cooperating organizations

The Welding Standards Committee, under whose direction this British Standard was prepared, consists of representatives from the following Government departments and scientific and industrial organizations:

- * Aluminium Federation
- Associated Metal Workers' Union
- Associated Offices Technical Committee
- British Constructional Steelwork Association
- British Railways Board
- * British Shipbuilders
- British Steel Industry
- Crown Agents for Oversea Governments and Administrations
- * Department of Trade (Marine Division)
- Health and Safety Executive
- Institution of Civil Engineers
- Institution of Electrical Engineers
- * Institution of Production Engineers

- * Institution of Structural Engineers
- Lloyd's Register of Shipping
- * Ministry of Defence
- Process Plant Association
- Society of British Aerospace Companies Limited
- Society of Motor Manufacturers and Traders Limited
- Water-tube Boilermakers' Association
- * Welding Institute
- * Welding Manufacturers' Association

The organizations marked with an asterisk in the above list, together with the following, were directly represented on the committee entrusted with the preparation of this British Standard:

- Association of Teachers in Technical Institutions
- British Institute of Non-destructive Testing
- City and Guilds of London Institute (Advisory Committee)
- Institution of Mechanical Engineers

Amendments issued since publication

Amd. No.	Date of issue	Text affected
Amd 6118	2 / 1989	Contents, New clause 7
Amd 7439	" / 1992	Standards Publication referred, Table 10